


After installation the flip camera, please use the following tools to activate the rearview function of the headunit:

CODING! VCDS Cable



- 1-open VCDS
- 2-click on Select control module

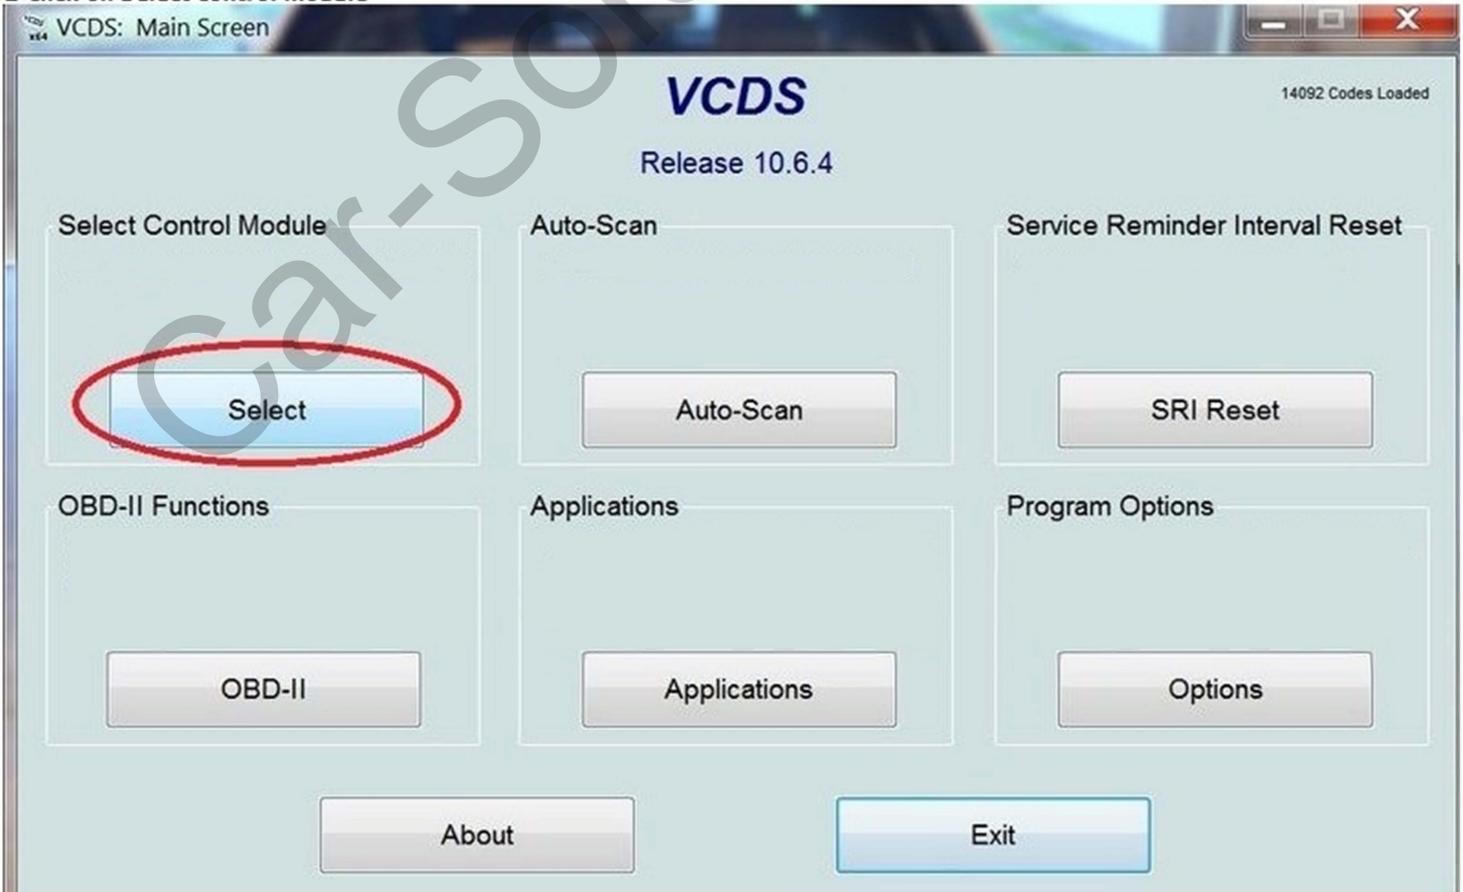

click on 37-Navigation

VCDS Release 10.6.4: Select Control Module

VCDS

Select Control Module

Installed	Drivetrain	Chassis	Comfort/Conv.	Electronics 1	Electronics 2
-----------	------------	---------	---------------	---------------	---------------

01-Engine	03-ABS Brakes	05-Acc/Start Auth.	08-Auto HVAC
09-Cent. Elect.	15-Airbags	16-Steering wheel	17-Instruments
19-CAN Gateway	25-Immobilizer	2B-Steer. Col. Lock	2E-Media Player 3
37-Navigation	42-Door Elect, Driver	44-Steering Assist	46-Central Conv.
47-Sound System	52-Door Elect, Pass.	55-Xenon Range	56-Radio

Direct Entry
Address Word (01-FF): |

click on coding-07

VCDS Release 10.6.4: 37-Navigation, Open Controller (1K0-035-27X-37.CLB)

VCDS

Open Controller

Comm Status
IC=1 TE=0 RE=0
Protocol: UDS

Controller Info

VAG Number:	1K0 035 274 B	Component:	RNS315-NAR H32 0263
Soft. Coding:	Long Coding	Shop #:	Imp: 011 WSC 01357
Extra:	3AA919866BNAR_V2		
Extra:	Geraet 00200		


Basic Functions These are "Safe"

Fault Codes - 02	Readiness - 15
Meas. Blocks - 08	Advanced ID - 1A


Advanced Functions Refer to Service Manual!

Coding II - 11	Coding - 07
Basic Settings - 04	Adaptation - 10

click long coding helper

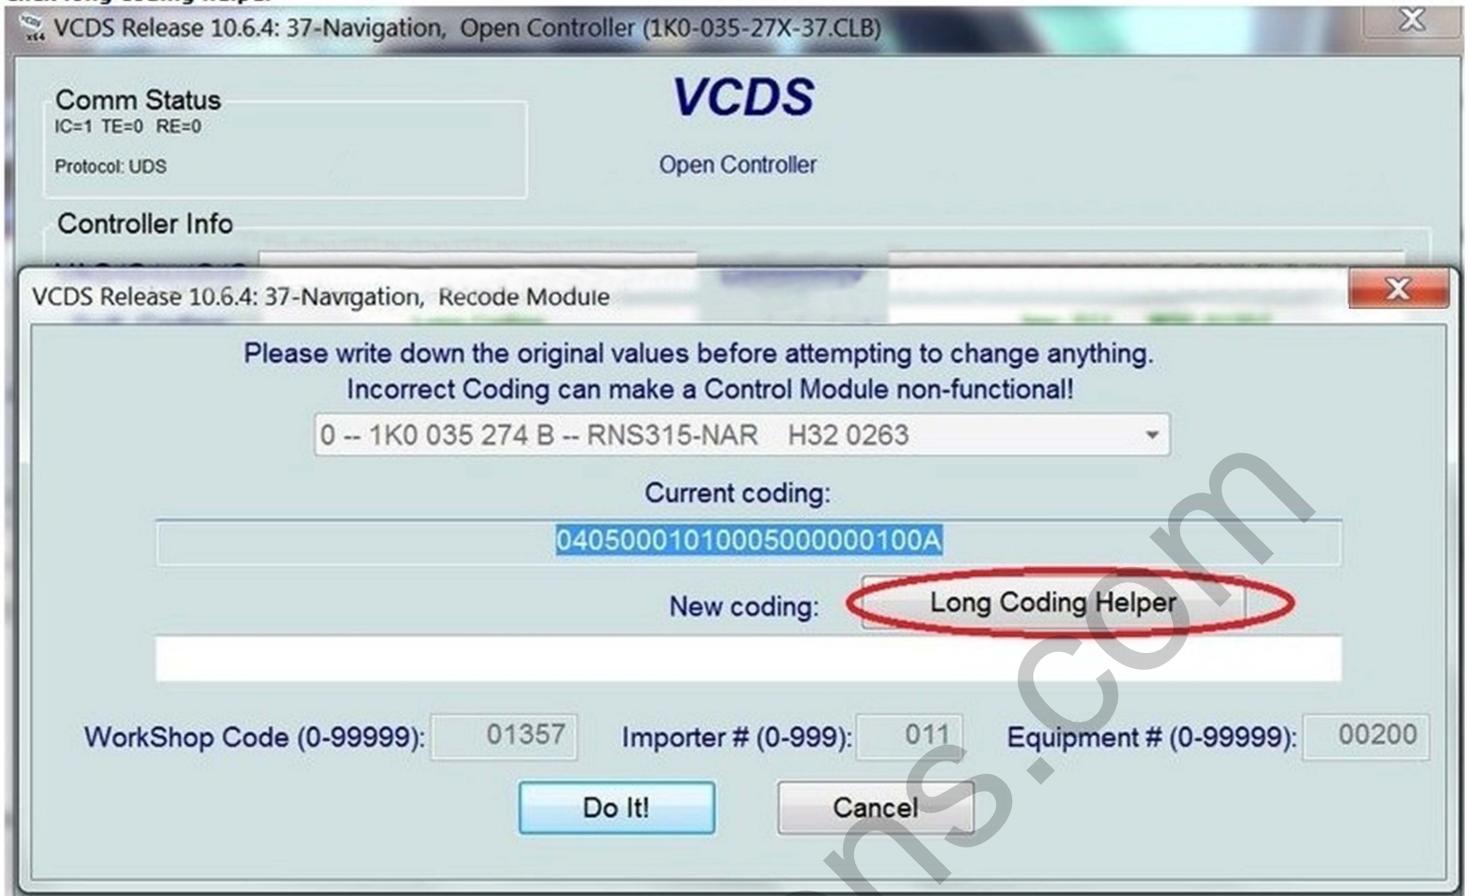

click on byte 3 (it is the 4th window from left....color will change from green to yellow)
checkmark Bit 6 (Rear-View-Camera(RVC) installed/active)
click exit to get back to prior window

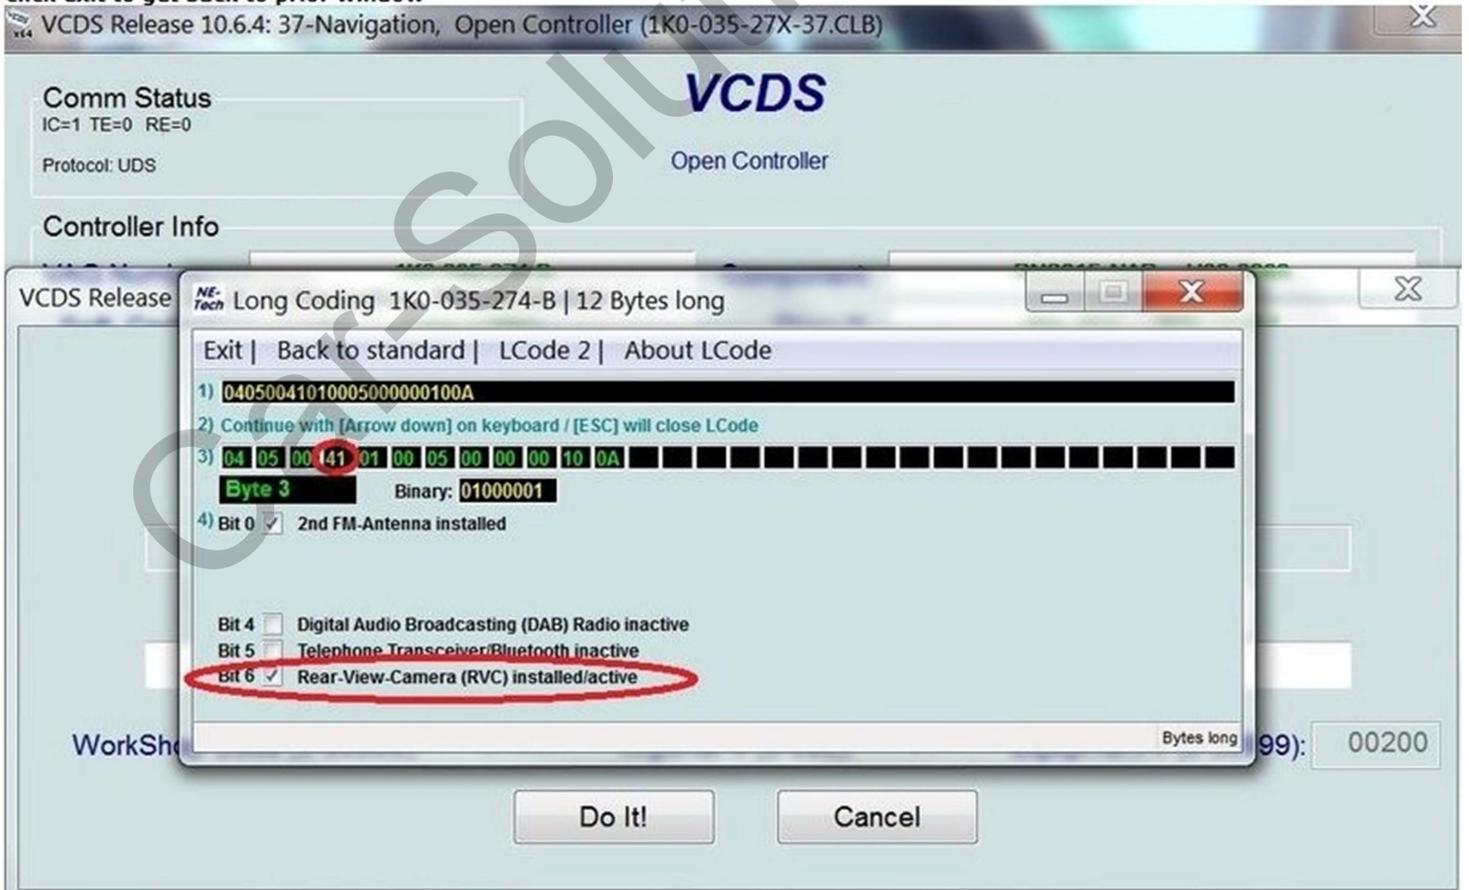

click Do It!

VCDS Release 10.6.4: 37-Navigation, Open Controller (1K0-035-27X-37.CLB)

VCDS
Open Controller

Comm Status
IC=1 TE=0 RE=0
Protocol: UDS

Controller Info

VCDS Release 10.6.4: 37-Navigation, Recode Module

Please write down the original values before attempting to change anything.
Incorrect Coding can make a Control Module non-functional!

0 -- 1K0 035 274 B -- RNS315-NAR H32 0263

Current coding:
04050001010005000000100A

New coding: Long Coding Helper
04050041010005000000100A

WorkShop Code (0-99999): 01357 Importer # (0-999): 011 Equipment # (0-99999): 00200

Do It! Cancel

coding accepted

VCDS Release 10.6.4: 37-Navigation, Open Controller (1K0-035-27X-37.CLB) (1K0-035-27X-37.CLB)

VCDS
Open Controller

Comm Status
IC=1 TE=0 RE=0
Protocol: UDS

Controller Info

VAG Number: 1K0 035 274 B Component: RNS315-NAR H32 0263

Soft. Coding: Long Coding Imp: 011 WSC 01357

Extra: V2

Extra:

Basic Functions These are "Safe" Functions Refer to Service Manual!

Fault Codes - 02 Readiness Coding II - 11 **Coding - 07**

Meas. Blocks - 08 Advanced ID - 1A Basic Settings - 04 Adaptation - 10

Supp. Codes - 18 Adv. Meas. Values Output Tests - 03 Security Access - 16

Close Controller, Go Back - 06

VCDS
Coding accepted
OK